

SERVICE INFORMATION



BULLETIN NO. 125

DATE: 02/03

75 West Plato Blvd. St. Paul, MN 55107
300 Jacksonville Rd. Warminster, PA 18974

RE: 223 Café Diemtm

SUBJECT: CUP CATCHER ASSEMBLY

Oversize coffee mugs damaging the cup catcher assembly (P/N 26600004) in the Café Diem cupwell have been reported. Damage to the cup catchers could ultimately cause interference with the cup sensors in the machine, creating an Out of Order condition.

After investigation, the cup catcher components were modified to improve critical strength points to prevent damage. The thickness of the material where the tension spring is connected was increased, and the lower pivot points were reinforced with the addition of an external rib.

This change was effective in production in September 2002, starting with S/N 22302244xxx

A special price of \$10.00 net each for replacement cup catcher assemblies will be in effect through March 31, 2004. Place your orders with your authorized APi distributor or the APi Warminster Parts Department.

