

DIXIE-MARCO CO, INC.
SERVICE BULLETIN #139

DATE: January 11, 1972

MODELS: All CFT Open Coolers for which complete Replacement Refrigeration Systems are furnished.

SUBJECT: Relocation of two (2) holes - - As Shown - - Fig. 1.
(If necessary).

REASON: To prevent the ends of the screws from entering the evaporator coil and causing a refrigerant leak.

- DO THIS:
- Before installing a replacement refrigeration system check to see if the hole dimension (right and left sides) is 1-3/8" as shown - Fig. 1.
 - If not (remove original screws) drill two (2) new holes in accordance with dimensions - - Fan Housing - Fig. 1.
 - Secure assembly with two (2) screws provided in Kit.

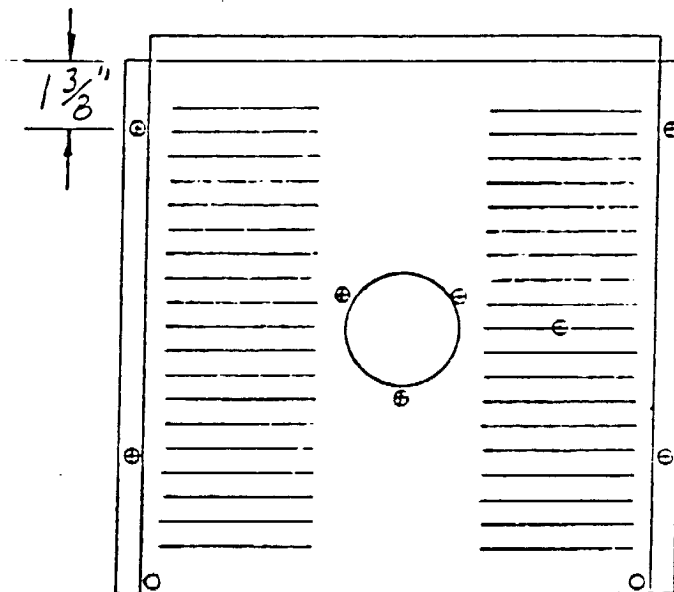


Fig. 1. Fan Housing Cover

KIT CONSISTS OF:

2 900,300,030.01 Screw, S/H, #8 x 3/8