

Technical Bulletin

Bulletin Number: 350 Revision Number: R-01

Release Date: March 28, 1988 Revision Date: December 7, 1998

SUBJECT: STICKING SELECT BUTTONS ON LANDSCAPES

MODEL: Coke Landscape Venders beginning serial number 0001-2949DK to 0001-2995BL.

REASON: To provide a correction for sticking select buttons in early Landscape models.


Parts Needed For Correction:

1 - 901,700,72x.x1	Spring
1 - 432,050,42x.x3	Z Bar Top
1 - 432,050,43x.x3	Z Bar Bottom


To correct sticking select button:

1. Replace the spring in the select button.
2. Replace the top and bottom Z Bars used to secure the switch bar assembly.

Note: Refer to TB 342 for Select Button / Switch Bar changes and part numbers.

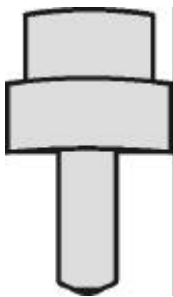

Select Button (Gray)
801,805,59x.x1
Figure 1

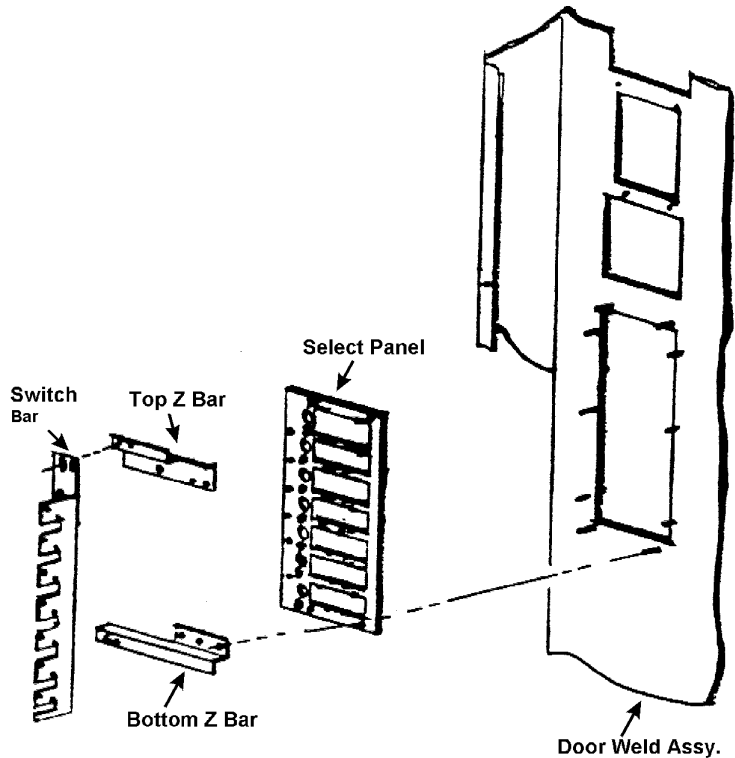

Old Style Switch Bar Assy.
(No longer available)
Figure 2