



3330 Dixie-Narco Blvd.  
Williston, SC 29853  
www.dixienarco.com

## M091.0 Extended Change Cup Kit for BevMax 2 and BevMax 3 Venders

7/31/07

**Models Affected:** All BevMax 2 and BevMax 3 Venders manufactured prior to 8776-0044CG (6/11/08).

**Reason:** To provide instructions for installing an Extended Change Cup assembly in BevMax 3 and BevMax 2 Venders that were produced prior factory installation.

**Order:** 647,010,90x.x4

Contents:      1 – 801,824,29x.x1      Extended Change Cup Assy.  
                    1 – 647,050,58x.x3      Extended Coin Cup Security Bracket  
                    1 – 801,823,42x.x1      Lower Coin Chute

\*Note: Depending on age of your BevMax 3 other parts may need to be purchased to make this conversion. These parts are included in the step by step instructions and will need to be ordered as required.

**Introductions:** Read entire instructions before beginning installation. If you have any questions, contact the Dixie Narco Customer Support Center before proceeding.

1. Open the Service Door.
2. Remove the existing Coin Cup Security Bracket and Coin Cup from the service door.



Original Coin Return Cup  
801,821,29x.x1



Original Coin Cup Security Bracket  
647,050,39x.x3

3. Remove existing Lower Coin Chute.
  - a. On Venders produced between 8542-0081AF to 8776-0044CG (6/11/08) remove the existing black plastic Lower Coin Chute.



- b. On Venders prior to 8542-0081AF remove the existing Coin Mech Housing Assembly.




4. Install new Lower Coin Chute.

- a. On Venders produced between 8542-0081AF to 8776-0044CG (6/11/08) install the new black plastic Lower Coin Chute (801,823,42x.x1).




Note lower half of chute cover has been removed.

- b. On Venders prior to 8542-0081AF install the new Coin Mech Housing Assembly (647,001,00x.x3).

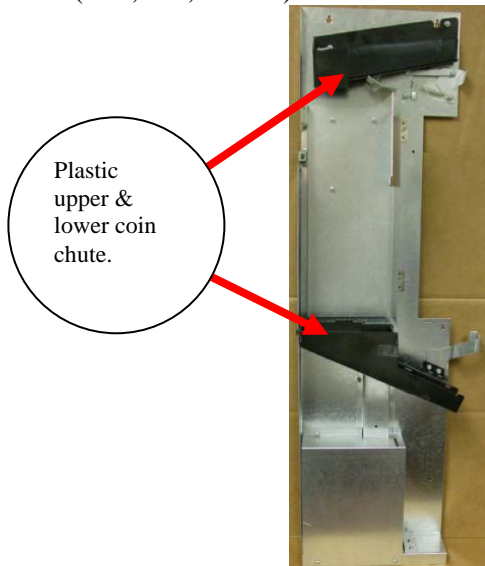

Plastic upper & lower coin chute.

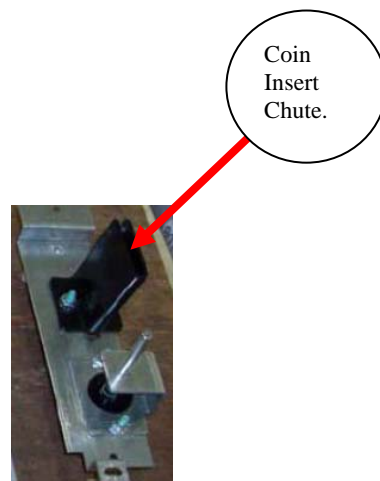

Coin Insert Chute.

- i. On Venders prior to 8542-0081AF if installing new Coin Mech Housing Assembly it is recommended you also install a new plastic Coin Insert Chute (801,823,55x.x1).

5. Install the new Extended Coin Cup Assembly (801,824,29x.x1).



Note cup is deeper to improve handling of increased number of coins and larger coins paid out.

- a. When replacing Coin Cup Assembly in BevMax 2 Venders prior to production run 8483 you will need to replace the Service Door Bezels with current Bezels and mounting screws (800,304,31x.x1).
6. Install the new Extended Coin Cup Security Bracket (647,050,58x.x3).



Note hole is larger to accommodate extended coin cup assy.

7. Close service door and test for proper operation and coin handling.