

SERVICE NOTICE 53 DN5000 Board Enhancements

Revised 11/16/03 To Our Valued Customers:

In our continuing effort to improve the quality of the Coke Glass Front Vender, we have made changes to the Machine Board, Universal (KO) Board, and Display Board in all DN5000 Venders.

Below you will find the descriptions of the enhancements, pictures of the new and old boards for comparison, replacement information, and serial breaks for factory installation. Replacement boards will only be provided as warranty exchanges, on failed boards, during the warranty period.

Below is a summary of the information provided in the following pages.

Machine Board Page 2 NEW MACHINE BOARDS (factory installed 8272CB-0077 and higher) Domestic/Japan Machine Board: 626,032,10x.x3 – New To Be Determined – New reconditioned **Export Machine Board:** To Be Determined - New reconditioned 626,032,20x.x3 – New Important: when using a New Machine Board the Universal (KO) software must be 804,914,991.01 or higher. OLD MACHINE BOARDS (No Longer Available- factory installed prior to 8272CB-0077) Domestic/Japan Machine Board: 626,030,30x.x3 – Old 495,061,15x.x3 – Old reconditioned **Export Machine Board:** 626.031.60x.x3 – Old 495.061.16x.x3 – Old reconditioned

Universal Board Page 3

NEW UNIVERSAL (KO) BOARDS(factory installed 8272CB-0077 and higher)Universal (KO) Board:626,056,30x.x4 - New495,061,24x.x3 - New reconditionedImportant: when using a New Machine Board the Universal (KO) software must be 804,914,991.01 or higher.0LD UNIVERSAL (KO) BOARDS(No Longer Available - factory installed prior to 8272CB-0077)Universal (KO) Board:495,061,12x.x3 - Old495,061,14x.x3 - Old reconditioned

Display Board Page 4

NEW DISPLAY BOARD(factory installed 8211DA-0203 and higher)Display Board:804,919,93x.x1 – NewNew Display is backward compatible but IR is not capable due to the Transaction Panels Display hole size.OLD DISPLAY BOARDS(No Longer Available - factory installed prior to 8211DA-0203)

Display Board: 804,914,86x.x1 – Old

MACHINE BOARD

Enhancements were made to the following functions of the Machine Board: elevator motor driver, solenoid drive, regulated 24VDC supply, and environmental circuit.



NEW BOARD

OLD BOARD



NEW BOARD & COVER

OLD BOARD & COVER

NEW MACHINE BOARDS (factory installed 8272CB-0077 and higher)

Domestic/Japan Machine Board:	626,032,10x.x3 – New	To Be Determined – New reconditioned
Export Machine Board:	626,032,20x.x3 – New	To Be Determined – New reconditioned
Important: when using a New Machine Board the Universal (KO) software must be 804,918,991.01 or higher.		
OLD MACHINE BOARDS (No Longer Available – factory installed prior to 8272CB-0077)		
Domestic/Japan Machine Board:	626,030,30x.x3 – Old	495,061,15x.x3 – Old reconditioned
Export Machine Board:	626,031,60x.x3 – Old	495,061,16x.x3 – Old reconditioned

UNIVERSAL (KO) BOARD

Enhancements were made to the following function of the Universal (KO) Board: radiated and conductive noise filtering, additional grounding to enhance sustaining memory.



NEW BOARD


OLD BOARD



NEW UNIVERSAL (KO) BOARDS (factory installed 8272CB-0077 and higher)Universal (KO) Board T8:626,056,30x.x4 – New495,061,24x.x3 – New reconditionedImportant: when using a New Machine Board the Universal (KO) software must be 804,918,991.01 or higher.0LD UNIVERSAL (KO) BOARDS (No Longer Available – factory installed prior to 8272CB-0077)Universal (KO) Board:495,061,12x.x3 – Old495,061,14x.x3 – Old reconditioned

DISPLAY BOARD

Enhancements were made to the following function of the Display Board: IR capable.

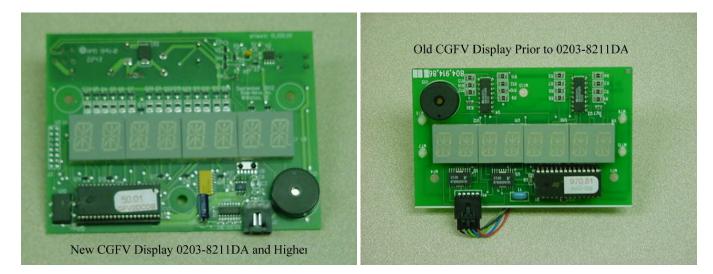

<u>NEW DISPLAY BOARD</u> (factory installed 8211DA-0203 and higher)

Display Board:

804,919,93x.x1 – **New** Software – 804,920,05x.x1

New Display is backward compatible but IR is not capable due to the Transaction Panels Display hole size. <u>OLD DISPLAY BOARDS (No Longer Available -</u> factory installed prior to 0203-8211DA) Display Board: 804,914,86x.x1 – Old

Software - 804,914,97x.x1

IMPORTANT: Display software is not compatible between the two different Display Boards.

If you have any questions, please feel free to contact the Dixie-Narco Technical Service Department in Williston, SC at 1-800-688-9090 or 803-266-5001.

Thank You for Your Business