

# Dixie-Narco®



Lawrence Street  
Ranson, West Virginia 25438

(304) 725-3481  
(800) 624-0553

## Service Bulletin #

234

Date: April 6, 1981  
Revised: June 22, 1981  
Revised: July 9, 1981

MODELS: INCB Venders.

- SUBJECT:
1. Sealing of the Rain Guard.
  2. Adding Water Trough above Select Switches.
  3. Sealing of the Trim.

Venders Produced before  
S/N 001-2426 March 81

Venders Produced before  
S/N 001-2452 July 81

- ORDER AS:
1. 903,600,370.01 1/8" Bead Black Uniseal (38" per vender).
  2. 267,010,500.03 Water Trough.

REASON: To provide a sealing compound that will adequately seal the Rain Guard and Trim. To provide a trough inside Select Panel above Select Switches to divert rain water which may get in coin slot.

On outside locations where the INCB Vender may be subjected to heavy driving rain storms it might be possible for water to get by the Rain Guard and down in the top of the Vertical Trim - See Fig. 1.

Also, water may enter coin slot. Drain teeth are provided in all coin insert castings at entrance to coin chute. This water can drain down the inside face of select panel. The trough provided will divert the water over to side, away from select switches.

See Fig. 2 for installation of trough.

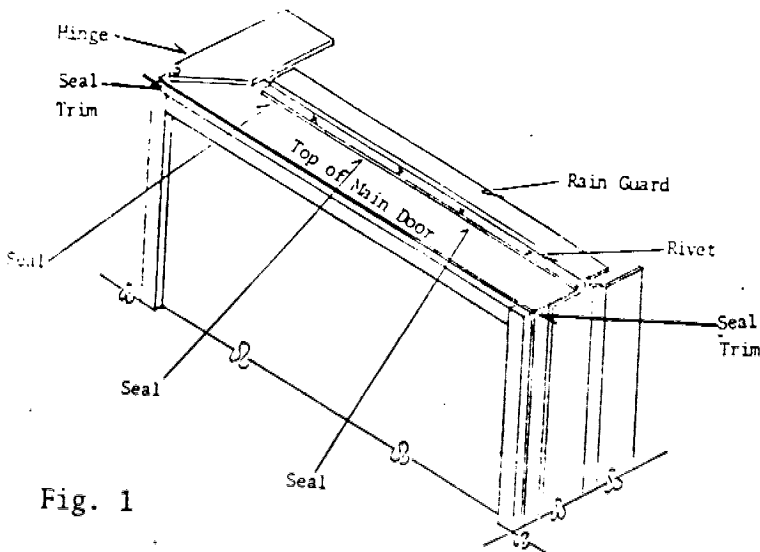


Fig. 1

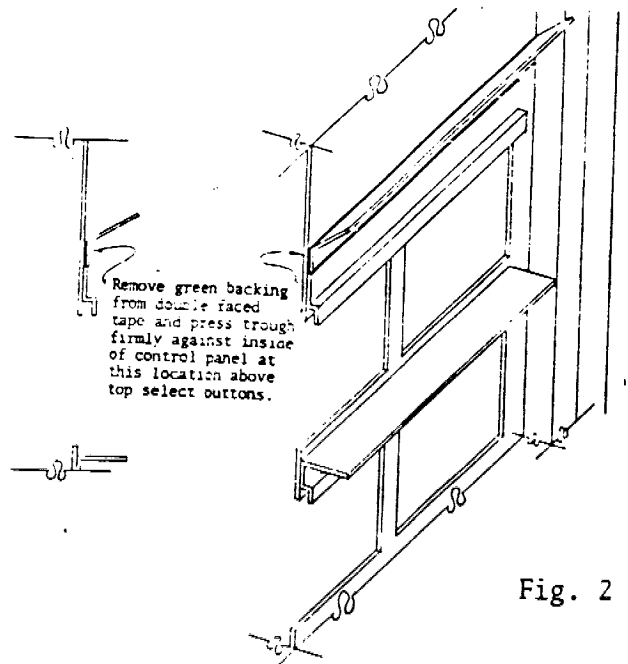


Fig. 2

CORRECTION: Seal along entire length at edge of Rain Guard. Seal also at each Pop Rivet. Also seal open ends at top of Vertical Trim. See Fig. 1

CORRECTION: Remove green backing from double faced tape and press trough firmly against inside of control panel at this location above top select buttons. See Fig. 2

Service Department  
DIXIE-NARCO, INC.