

**TOMORROW'S
MANUFACTURING
LEADERSHIP
TODAY**

Technical Bulletin

Bulletin Number: 367 Revision Number: R-01

Release Date: July 11, 1988 Revision Date: August 31, 1992


SUBJECT: MARS, MAKA, AND BILLTRON DOLLAR BILL VALIDATOR MOUNTING

REASON: Sequencer Interference

MODELS: DNCB CC Circular Coke

PRODUCTION

RUN AFFECTED: 3067CM, only

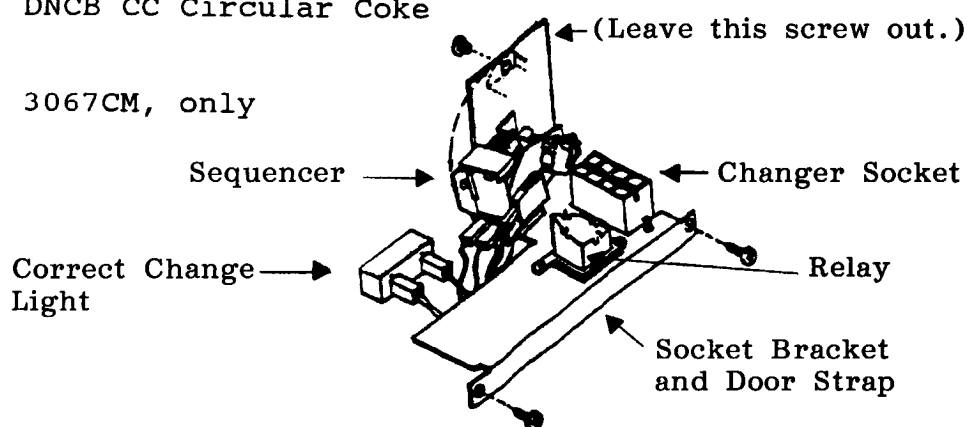

The following instructions are to be used when installing a Mars, Maka or Billtron Validator on any Coca-Cola CC vender that was manufactured on production run 3067.60 only. The sequencer interferes with the installation of the above validator and must be slightly relocated.

1. Unplug the vender.
2. Unplug the two (2) wires connected to the Correct Change Light.
3. Remove the two (2) screws holding the Socket Bracket to the door frame and vertical bulkhead.
4. Pull the bracket out of the door.
5. Remove the screw from the top of the bracket holding the sequencer and rotate the sequencer as per the drawing above.
6. Tighten the remaining screw holding the sequencer on the bracket.
7. Re-install the bracket in the door using the two (2) screws removed earlier.
8. Plug in the two (2) wires to the Correct Change Light.
9. Plug in the vender.