
**KIT PART NUMBER 4550010
INSTRUCTIONS FOR THE 455 COMPRESSOR JUMPER KIT
FOR THE 455 MACHINE.**

CHECK THE PARTS RECEIVED IN THIS KIT WITH THE PARTS LIST IN THESE INSTRUCTIONS. IF ANY PARTS ARE MISSING CONTACT THE CRANE MERCHANDISING SYSTEMS' PARTS DEPARTMENT AT 1-800-621-7278.

Read these instructions carefully before installing the kit.
Keep these instructions for part numbers and for future reference.

THIS KIT CONTAINS THE FOLLOWING:

PART NUMBER	DESCRIPTION	QTY
4559029	JUMPER 7 INCH	1
9985993	TERMINAL - .250 TAB	1
4042121	WIRE TIE-#PLT1M-M20	1
4550009	INSTRUCTIONS-455 COMPRESSOR RELAY KIT	1

WARNING: Electrical Shock Hazard - Turn machine off before installing this kit. Failure to do so could result in electrical shock.

1. Read these instructions carefully before installing this kit.
2. Turn the machine OFF with the main switch. Failure to do so could result in an electrical shock.
3. Remove the board covers from the monetary section.
4. Unplug the double red wire from the triac. Plug the terminal supplied in the kit into the double red wire connector.
5. Plug one end of the supplied jumper into the empty triac terminal.
6. Plug the other end of the jumper into the empty terminal on the heater relay.
7. Place the wire tie around the double red wires, the new jumper, and an existing wire bundle.
8. Replace the covers.
9. Turn the main switch back on.
10. Close the door.

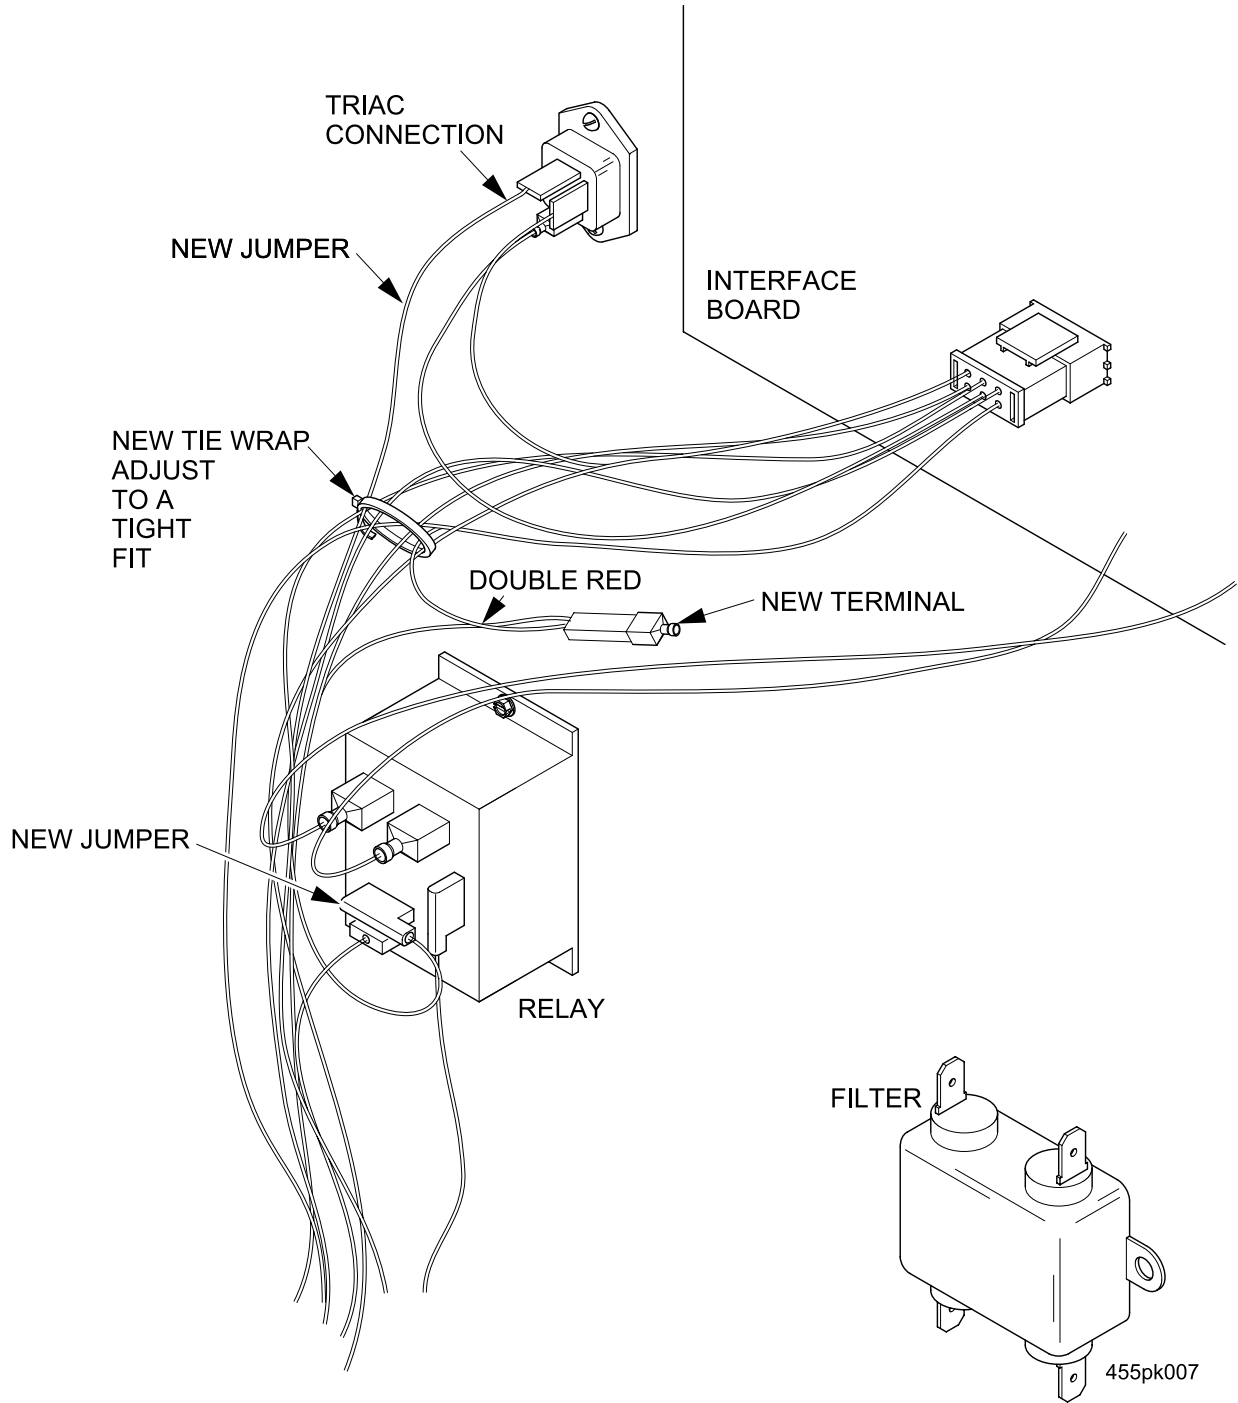


Figure 1