

SERVICE INFORMATION

M143.0

MODELS AFFECTED: All BevMax Media (6) and BevMax 4 and 3 Model Venders with Coin Mechanism Door Magnet Latch.

MODEL NUMBERS: DN5800-6, DN3800-6, DN5800-4, DN3800-4, DN5800-3, & DN3800-3.

Date: 6/24/16

RE: BevMax Media (6) & BevMax 4/3 Refurb Double Roller Door Latch Installation.



Reason: This service bulletin provides instructions for installing a Coin Mechanism Double Roller Door Latch to enhance securing the Coin Mechanism Door in the closed position in BevMax Media (6) and BevMax 4/3 venders.

Tools required:

- Angle Drill/Driver
- 1/8 " Drill Bit
- Diagonal cutter
- Philips driver
- Pop rivet gun

Refurb Upgrade Kit #: 65701680

Parts included:(QTY) Part Description


- 1 – Double Roller Catch
- 4 - 1/8" steel rivets
- 1 - Drill template for Dart & Latch mounting
- 2 - 7.5" cable tie
- 1 - Cable Clamp w Adhesive
- 1 - M142.x Instructions

CRANE[®] MERCHANDISING SYSTEMS

SERVICE INFORMATION

ACTION:

During the remanufacturing process it is recommended to remove the magnetic strip and replace it with the double roller latch.

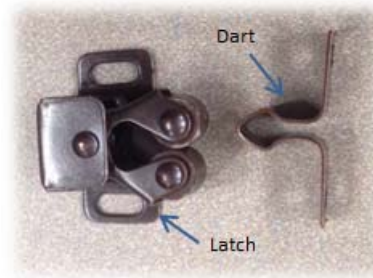

Installation


Parts Removal:

<p>Rotate coin mech door and remove Coin Mech.</p>	<p>Pull Up on Coin Mech Door to remove it from the hinges.</p>	<p>Remove Magnet From Cabinet & Wire Clamp from Coin Door</p>

CRANE[®] MERCHANDISING SYSTEMS

SERVICE INFORMATION

New Parts Installation:



- Use provided template to mark holes in side of cabinet and on access door
- Drill 1/8" holes in marked location on both cabinet and access door.
- Install dart on cabinet wall with pop rivets provided.
- Install latch on access door with pop rivets provided
- Reinstall Coin Door and ensure dart aligns with latch

Contact Crane Merchandising Systems Parts Order Entry Team for purchasing kit at 803-266-5001 then press 3.

If you have any issues please contact your Crane Merchandising Systems Representative or the Technical Service Department at 803-266-5001 then press 4.