

Dixie-Narco®



Lawrence Street
Ranson, West Virginia 25438

(304) 725-3481
(800) 624-0553
240

Service Bulletin # _____ Date: September 10, 1981

MODEL: DNCB 630/360-5 and -6

SUBJECT: Vend Motor Assembly with original Linkage Arm - C236,070,200.13.

EFFECTIVE: Serial Number 0001 2470CF
Approximate Date 9/18/81


REASON: Since the diameter of the pin on the oscillator has been increased, then the ID of one of the holes in the linkage arm has been increased also.

Vend Motor assemblies will continue to be shipped with the original linkage arm. So that the Vend Motor will adapt to any DNCB 630/360-5 & -6, the revised linkage arm will be included but not installed.

KIT WILL CONSIST OF:

1	A801,201,030.01	Linkage Arm-Revised
1	801,804,770.01	Nyliner-Revised
1	801,803,160.01	Nyliner-(No Change Made)


CAUTION: Make sure the Linkage Arm is compatible with the pin of the oscillator.

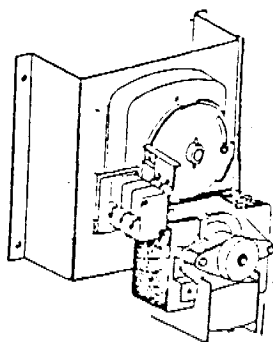

Vend Motor



Linkage Arm

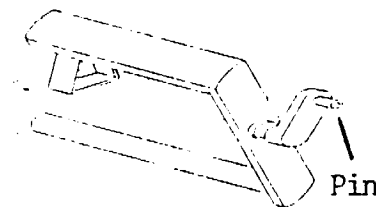

Oscillator

PARTS SHOWN ARE FOR REFERENCE ONLY

Service Department
DIXIE-NARCO, INC.